




Wiring Diagram

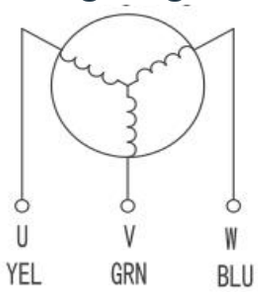

Holzer Sensor Wiring Diagram

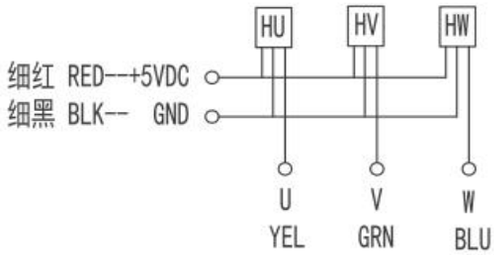

Appearance Size & Motor Installation

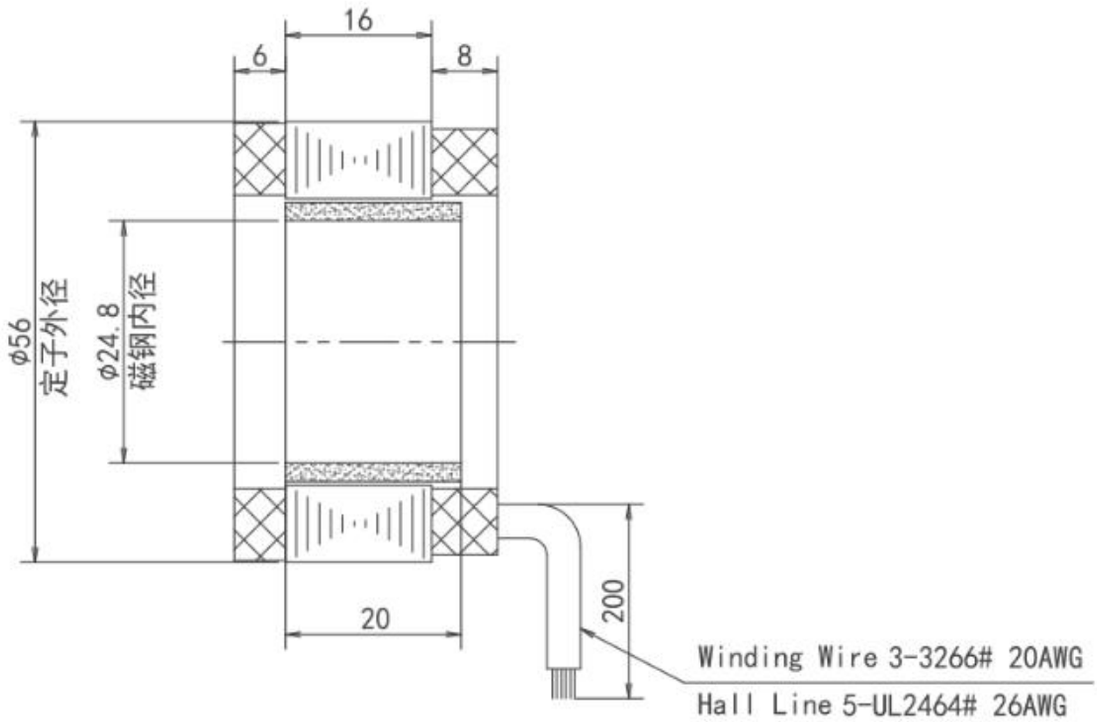

Electrical Specification

Motor Model		FB561
Number of Phase		3
Number of Poles		16
Rated Voltage	VDC	48
Rated Speed	Rpm	3000
Rated Torque	N.m	0.3
Rated Powe	W	95
Rated Current	A	2.9
Peak Current	A	8.7
Peak Torque	N.M	0.9
Rotor Inertia	kg.cm2	0.15
Torque Constant	N.m/A	0.1
Torque Constant	V/krpm	9.5
Line-Line Resistance	Ω	1.5
Line-Line Inductance	mH	2.1
Length	mm	16
Weight	kg	0.5
*Note： We can manufacture products according to customer’s requirements.		

* Note: We can manufacture products according to customer's requirements. Optional accessory is the encoder and brake to match this product.

* Contact sales@ichmo.com.